



# SERVICE BULLETIN

## Health Imaging Products

Eastman Kodak Company, Health Imaging, Rochester, NY 14650

SERVICE BULLETIN NO. 315

FEBRUARY 2004

### 3479 *Kodak* MINILOADER 2000P

#### Possible light leak after MOD 11 installation

**!! IMPORTANT !!**

### Immediate Action Required

Service Bulletin 313, dated December 2003, was sent out to instruct field service personnel to correct a possible light leak on any *Kodak* MINILOADER 2000P that had MOD 11 installed.

We are issuing this reminder because field feedback indicates that in many cases this important equipment repair has not been done.

**Any *Kodak* MINILOADER 2000P that had MOD 11 installed must be updated by adding a new FOAM STRIP. This must be done as soon as possible, to prevent the possibility of a light leak.**

All MOD 11 kits made after November 2003 have the FOAM STRIP included in the kit.

Here's what to check at each site.

1. Is MOD 11 circled on the MODIFICATION STICKER for the MINILOADER 2000P?
2. If yes, remove the PROCESSOR BACK PANEL.
3. Is a FOAM STRIP installed on the PROCESSOR FRAME as shown in Service Bulletin 313?
4. If yes, no further action is required. Re-install BACK PANEL on the PROCESSOR.
5. If no, install FOAM STRIP using the instructions in Service Bulletin 313.

#### Ordering FOAM:

PN **H9281026** FOAM STRIP 25 in. (63.5 cm), cut to exact length. (Available at no charge)

PN **650938** 2 FOAM ROLLS, enough for ~ 8 installations. (No charge if used for MOD 11)

**David Guild, Service Engineer – Rochester, NY**

**For more information please contact:**

**Eastman Kodak Company  
Health Imaging  
1-800-328-2910 (U. S. Only)  
651-393-1728 (Outside the U.S.A.)**

*Kodak* is a trademark.

Printed in the USA. Pub No. 6F5545

©Eastman Kodak Company, 2004  
Rochester, NY 14650

**HEALTH IMAGING**

